




Datamate Connectors

Female Vertical PC Tail

- ❖ Fully shrouded contacts.
- ❖ Polarised mouldings.
- ❖ Mates with male connectors shown on pages 34-40 and 42-43.

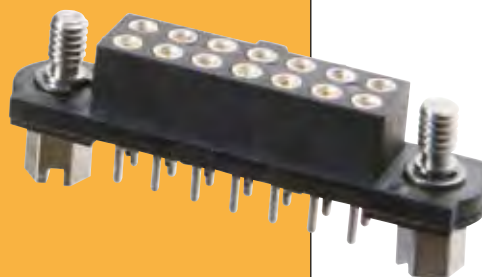

WITHOUT JACKSCREWS

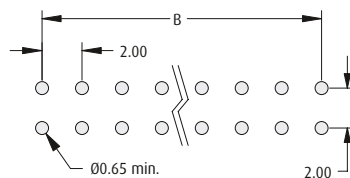
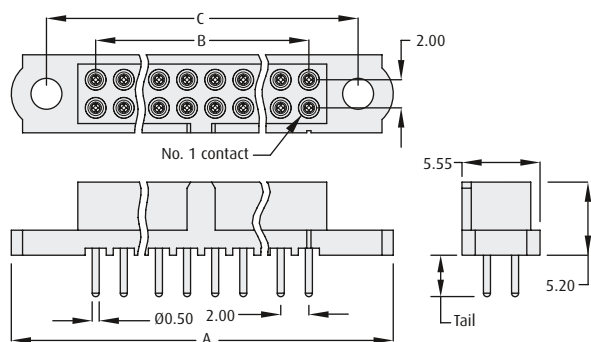


Recommended PC Board Pattern

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITH JACKSCREWS

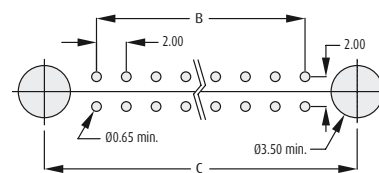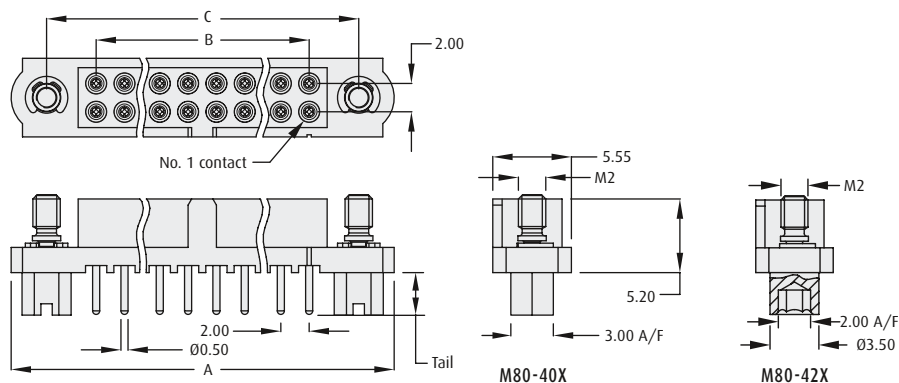

Recommended PC Board Pattern

HOW TO ORDER

SERIES CODE

0	With Hex slotted jackscrews
1	Without jackscrews
2	With Hex Socket jackscrews

0	3mm Tails
1	4.5mm Tails

M80 - 4 X X XX XX

FINISH

01	Gold + Tin/Lead	
05	Gold	
42	Gold + Tin	

TOTAL NO. OF CONTACTS


04 to 50

Even numbers only

All dimensions in mm.

www.harwin.com



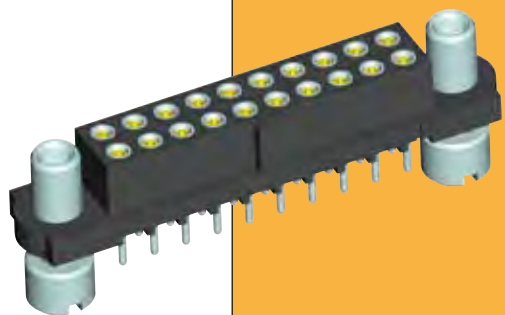

Datamate Connectors



Female Vertical PC Tail Reverse Fix

- ❖ Fully shrouded contacts.
- ❖ Polarised mouldings.
- ❖ Mates with male connectors shown on page 41.



WITH JACKSCREWS

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

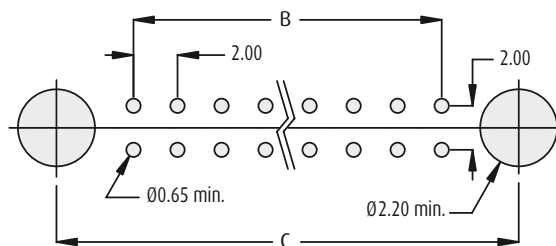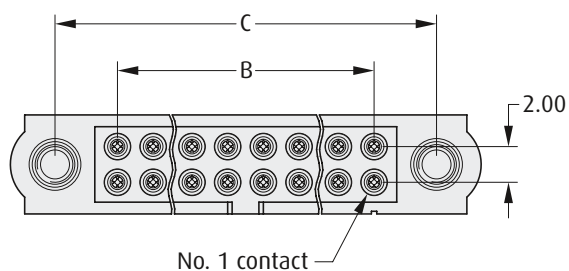

Recommended PC Board Pattern

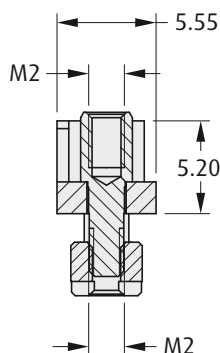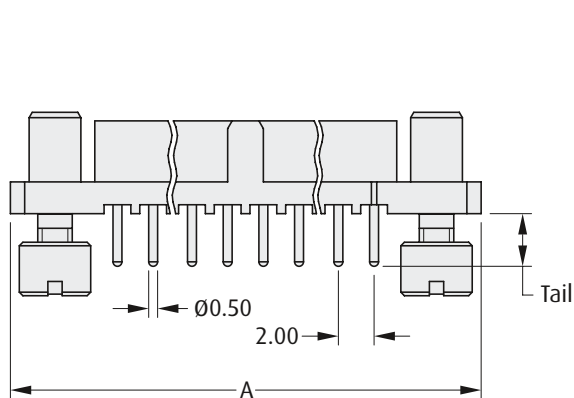

HOW TO ORDER

M80 - 40 X XX XX

SERIES CODE

TYPE

5	3mm Tails
6	4.5mm Tails

FINISH

01	Gold + Tin/Lead	
05	Gold	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

www.harwin.com

All dimensions in mm.




HARWIN



Datamate Connectors

Female Vertical Surface Mount

- ❖ Optional pick and place cap.
- ❖ Contact datamate@harwin.com for tape and reel options.
- ❖ Gull wing SMT tails simplify inspection process.
- ❖ Mates with male connectors shown on pages 34-40 and 42-43.

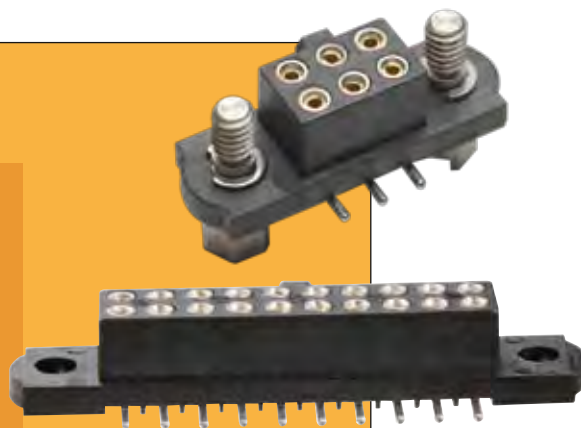

WITHOUT JACKSCREWS

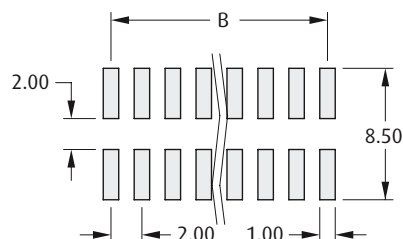
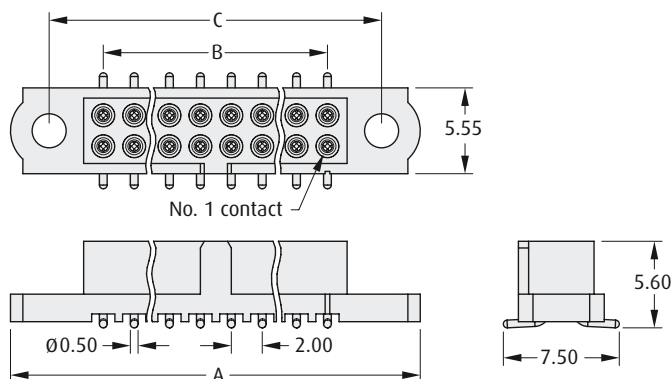


Recommended PC Board Pattern

CALCULATION

A	B + 12
B	Total No. of contacts - 2
C	B + 7

WITH JACKSCREWS

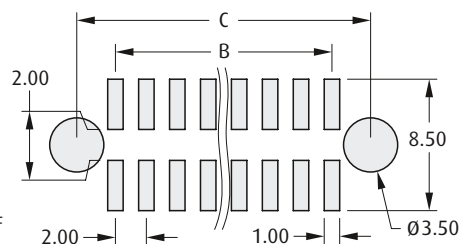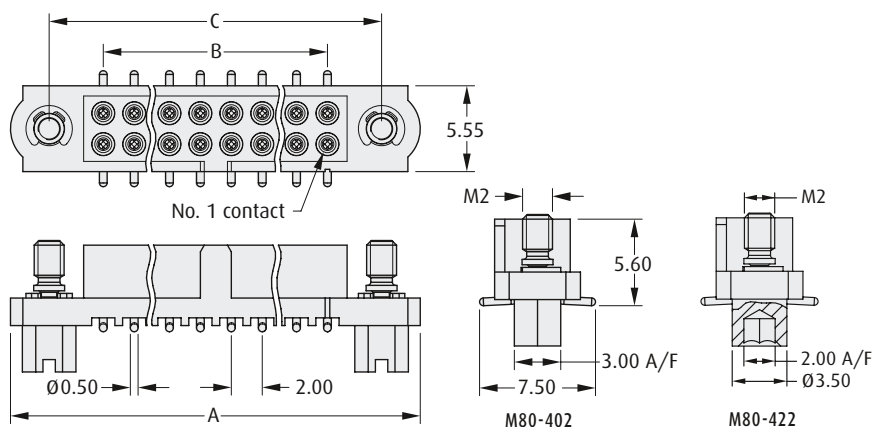

Recommended PC Board Pattern

HOW TO ORDER

M80 - 4 X 2 XX XX P

SERIES CODE

TYPE

0	With Hex slotted jack screws
1	Without Jack screws
2	With Hex Socket jack screws

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

PICK AND PLACE CAP

BLANK	No cap
P	Pick and place cap

FINISH

01	Gold + Tin/Lead	
05	Gold	
42	Gold + Tin	

All dimensions in mm.

www.harwin.com




Datamate Connectors


Female Crimp

- ❖ Polarised mouldings.
- ❖ Fully shrouded contacts.
- ❖ Large bore 22 AWG, small bore 24-28 AWG.
- ❖ Jackscrews are assembled where specified.
- ❖ Crimp contacts are rear insertable.
- ❖ Mates with male connectors shown on pages 34-40 and 42-43.
- ❖ Part numbers are for housings and the equivalent no of contacts.
- ❖ Spare contacts available, see page 16.

WITHOUT JACKSCREWS

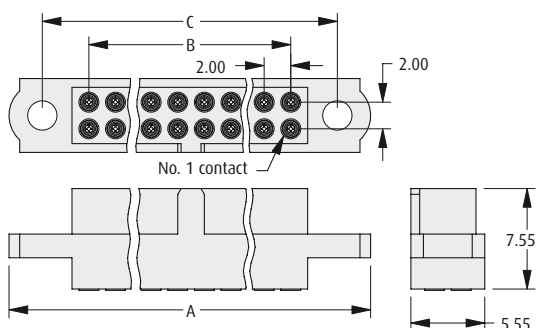

WITH JACKSCREWS

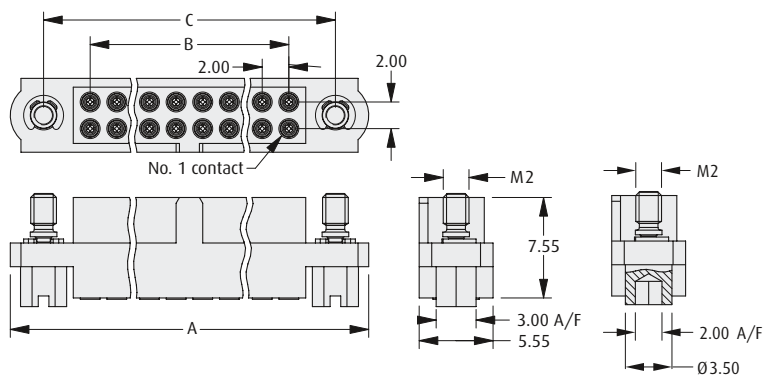

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

M80-460
M80-461

M80-480
M80-481


TOOLS

Recommended Crimp Tool - M22520/2-01
Positioner - T5747

Contact Insertion/Removal Tool - Z80-280
See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

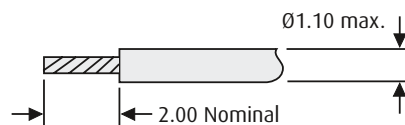

HOW TO ORDER

M80 - XXX XX XX

SERIES CODE

TYPE

460	Large Bore, with Jackscrews*	471	Small Bore, without Jackscrews
461	Small Bore, with Jackscrews*	480	Large Bore, with Hex Jackscrews
470	Large Bore, without Jackscrews	481	Small Bore, with Hex Jackscrews

* Slotted

FINISH

05	Gold	PG
42	Gold + Tin	PG

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

www.harwin.com

All dimensions in mm.



HARWIN

Datamate Connectors

Female Crimp Trio-Tek

Datamate Trio-Tek



- ❖ Crimp inspection window in housing.
- ❖ Mates with Male connectors shown on pages 34 to 43.
- ❖ Contacts available separately, see page 16.
- ❖ Triangular contact design for automated assembly equipment.
- ❖ Ideal for volume applications.




WITH JACKSCREWS

CALCULATION


A	$B + 12$
B	Total No. of Contacts - 2
C	$B + 7$

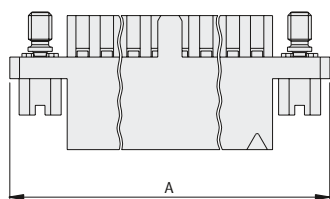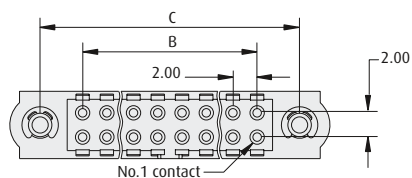


HEX SLOTTED

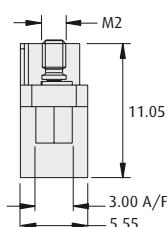


HEX SOCKET

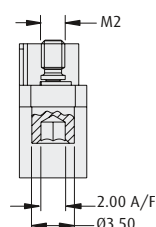


REVERSE FIX

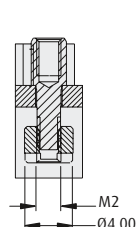

GUIDE PIN WITH PANEL MOUNT



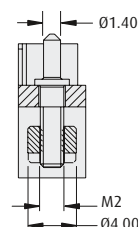


101 Lok

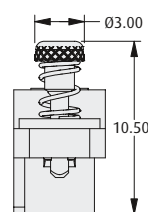

WITHOUT JACKSCREWS

TOOLS

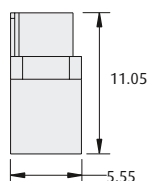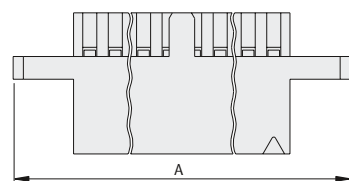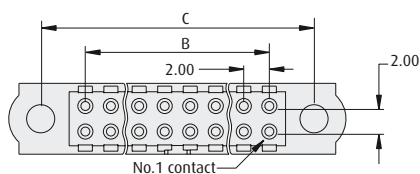


Recommended Crimp Tool - Z80-255

Contact Removal Tool - Z80-258

See page 78

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

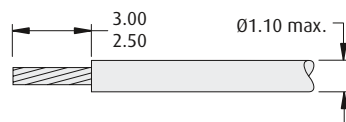

HOW TO ORDER

M80 - 45X XX XX

SERIES CODE

HOUSINGS

454	Without Jackscrews	457	Reverse Fix Jackscrews
455	Hex Slotted Jackscrews	458	Guide pin with panel mount
456	Hex Socket Jackscrews	459	101Lok jackscrews

FINISH

98 Housings




TOTAL NO. OF CONTACTS

06, 08, 10, 12, 14, 20, 26, 34, 42, 50

All dimensions in mm.

www.harwin.com



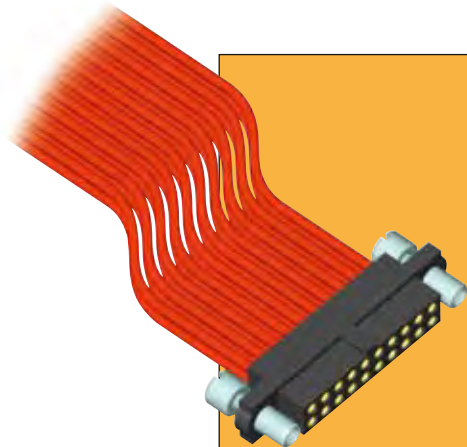

Datamate Connectors


Female Crimp Reverse Fix

- ❖ Mates with male connectors shown on page 41.
- ❖ Allows for further flexibility in system design.
- ❖ Crimp contacts supplied loose.
- ❖ Crimp contacts are rear insertable.
- ❖ Large bore 22 AWG, small bore 24-28 AWG.
- ❖ Part numbers are for housings and the equivalent number of contacts.
- ❖ Spare contacts are available – see page 16.

WITH JACKSCREWS

CALCULATION

A	$B + 12$
B	Total No. of contacts – 2
C	$B + 7$

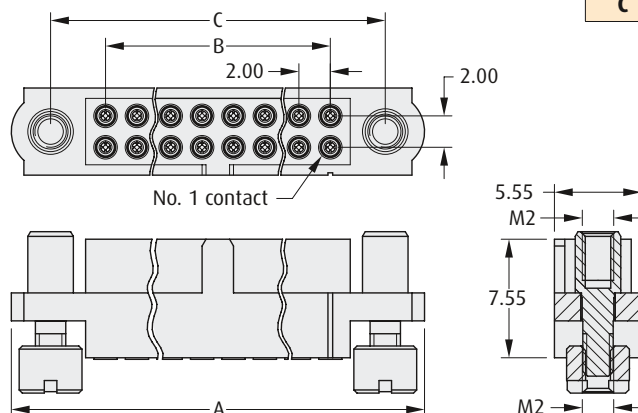

TOOLS

Recommended Crimp Tool – M22520/2-01


Positioner – T5747

Contact Insertion/Removal Tool – Z80-280

See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

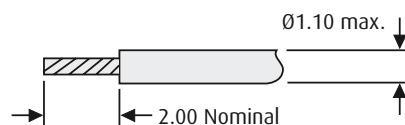

HOW TO ORDER

M80 - XXX XX XX

SERIES CODE

TYPE

462	Large Bore Connector
463	Small Bore Connector

FINISH

05	Gold	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

www.harwin.com

All dimensions in mm.



HARWIN


Datamate Connectors

Female Crimp Extended Wall

- ❖ Extended Wall Datamate allows back potting to be performed.
- ❖ Polarised mouldings.
- ❖ Crimp contacts are rear insertable.
- ❖ Large bore 22AWG, small bore 24-28 AWG.
- ❖ Part numbers are for housings and the equivalent no. of contacts.
- ❖ Mates with male connectors shown on pages 34-40 and 42-43.
- ❖ Spare contacts are available – see page 16.




WITHOUT JACKSCREWS

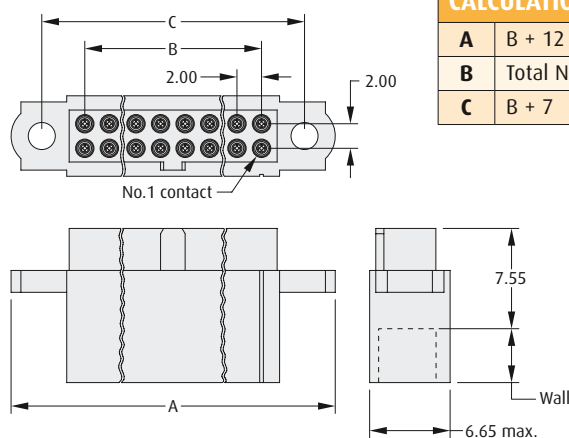

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITH JACKSCREWS

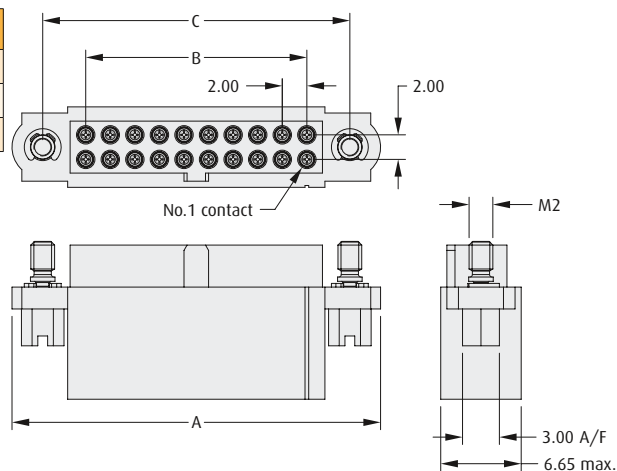

TOOLS

Recommended Crimp Tool – M22520/2-01


Positioner – T5747

Contact Insertion/Removal Tool – Z80-280

See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

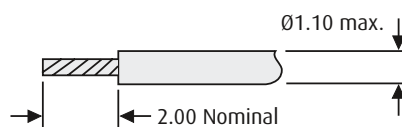

HOW TO ORDER

M80 - XXX XX XX

SERIES CODE

TYPE

465	Large Bore, with jackscrews*	476	Small Bore, without jackscrews
466	Small Bore, with jackscrews*	485	Large Bore, with hex jackscrews
475	Large Bore, without jackscrews	486	Small Bore, with hex jackscrews

*Slotted

WALL SIZE

BLANK	Wall = 5mm
A	Wall = 1mm

FINISH

05	Gold	PG
42	Gold + Tin	PG

TOTAL NO. OF CONTACTS

06,10,12,14,18,20,26,34,42,50

All dimensions in mm.

www.harwin.com





Datamate Connectors

Female Crimp with Hood



- ❖ Supplied as a complete kit, including hood, screws, connector, contacts and jackscrews.
- ❖ For spare crimp contacts, see page 16.
- ❖ Provides strain relief by preventing cable bending at the rear of the connector, and also has the option of inserting a cable tie to reduce pull strain.
- ❖ Mates with male connectors shown on pages 34-40 and 42-43.

FEMALE

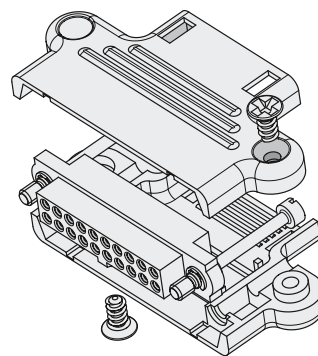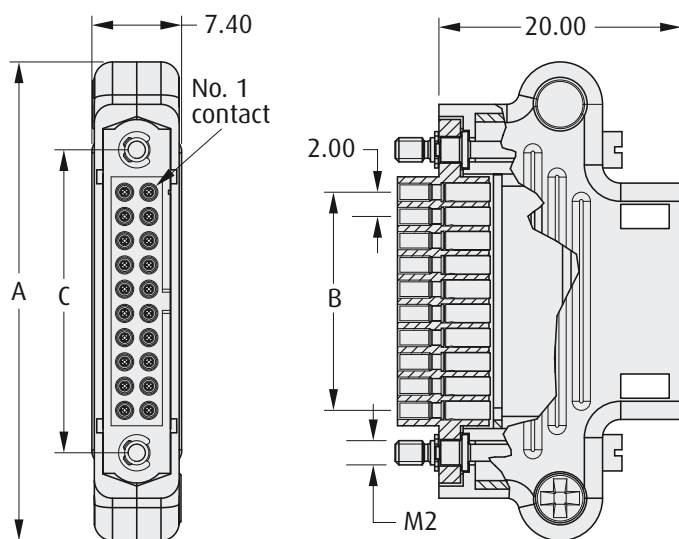

TOOLS

Recommended Crimp Tool – M22520/2-01
Positioner – T5747


Contact Insertion/Removal Tool – Z80-280
 See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

CALCULATION

A	$B + 21.5$
B	Total No. of contacts – 2
C	$B + 7$

WIRE STRIPPING DETAILS



HOW TO ORDER

M80 - 94 X XX XX

SERIES CODE

TYPE

0	Small Bore
1	Large Bore

FINISH

05	Gold	PG
42	Gold + Tin	PG

TOTAL NO. OF CONTACTS

06, 10, 12, 14, 20, 26, 34, 42, 50

www.harwin.com

All dimensions in mm.





HARWIN

Datamate Connectors

Male Vertical PC Tail

- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Polarised mouldings.
- ❖ Fully shrouded contacts.
- ❖ Jackscrews are assembled where specified.
- ❖ Choice of PC Tail length.

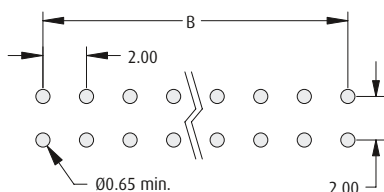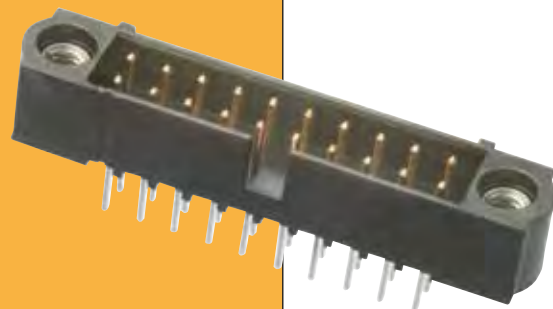


Recommended PC Board Pattern


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITHOUT JACKSCREWS

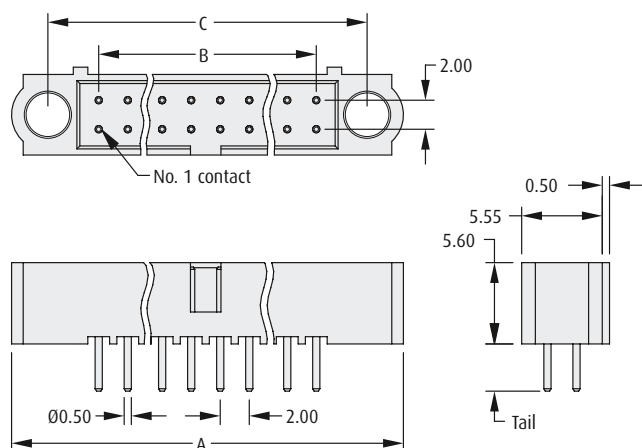

WITH JACKSCREWS

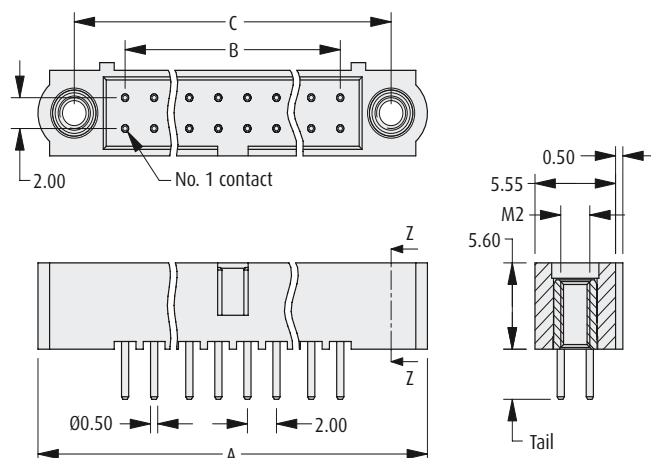

HOW TO ORDER

M80 - 5 X X XX XX

SERIES CODE

0	With Jackscrews
2	Without Jackscrews

0	3mm Tails
1	4.5mm Tails

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

All dimensions in mm.

www.harwin.com




Datamate Connectors

Male Horizontal PC Tail



- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Jackscrews are assembled where specified.
- ❖ Choice of PC Tail length.

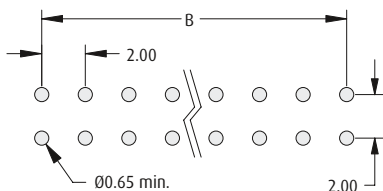


Recommended PC Board Pattern


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITHOUT JACKSCREWS

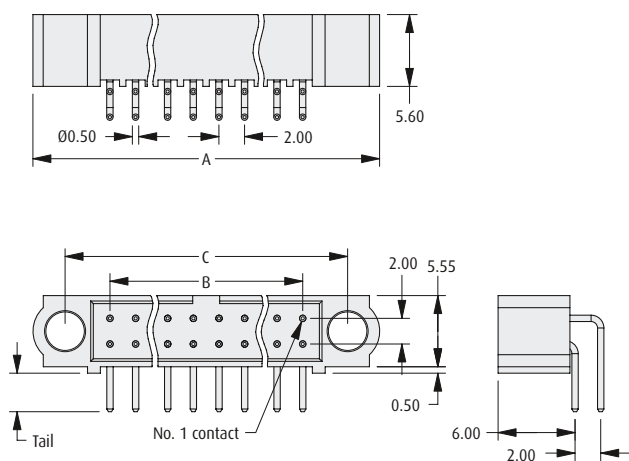

WITH JACKSCREWS

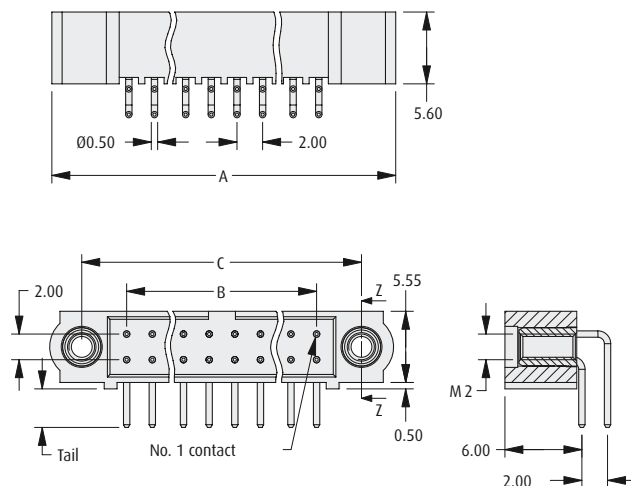

HOW TO ORDER

M80 - 5 X X XX XX

SERIES CODE

3	With Jackscrews
5	Without Jackscrews
0	3mm Tails
1	4.5mm Tails

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

www.harwin.com

All dimensions in mm.





HARWIN

Datamate Connectors

Male PC Tail with Board Mount

- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Board mounts provide PCB strain relief.

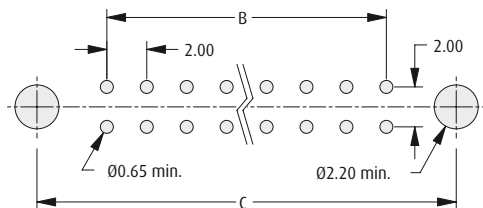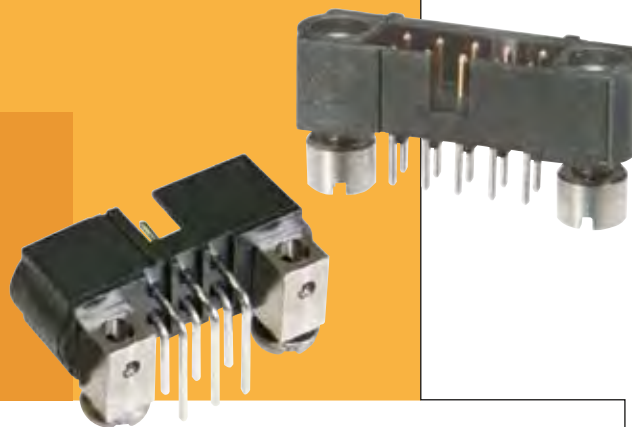


Recommended PC Board Pattern


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

VERTICAL

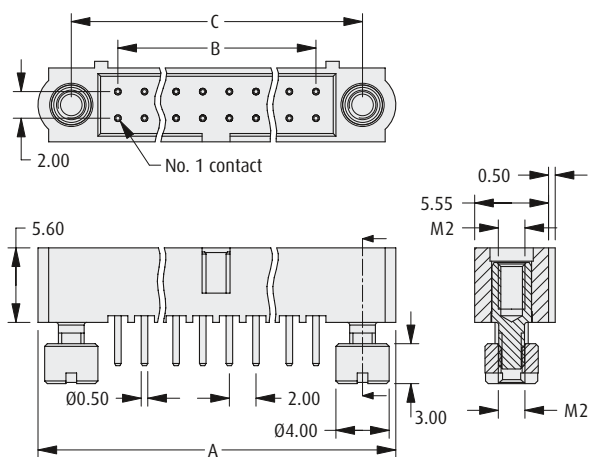

HORIZONTAL

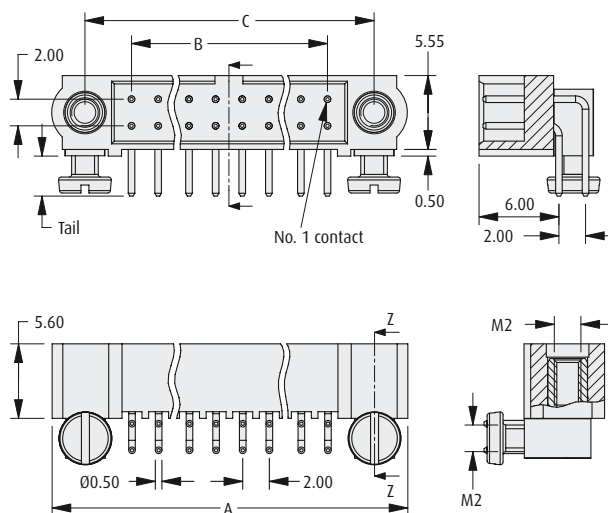

HOW TO ORDER

M80 - 5 X X XX XX

SERIES CODE

1	Vertical
4	Horizontal
0	3mm Tails
1	4.5mm Tails

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

TOTAL NO. OF CONTACTS


04 to 50

Even numbers only

All dimensions in mm.

www.harwin.com




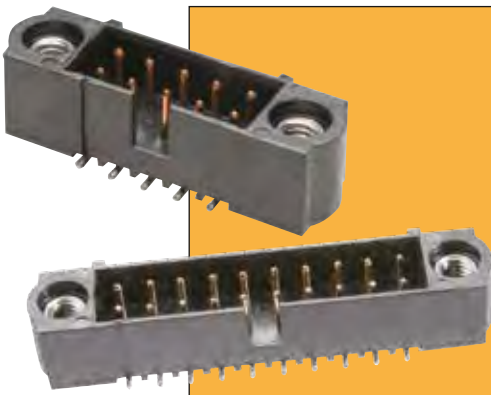

Datamate Connectors

Male Vertical Surface Mount

- ❖ Contact datamate@harwin.com for tape & reel options.
- ❖ Optional pick and place cap.
- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Gull wing SMT tails simplify inspection process.

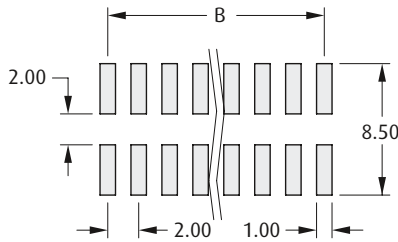


Recommended PC Board Pattern


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITHOUT JACKSCREWS

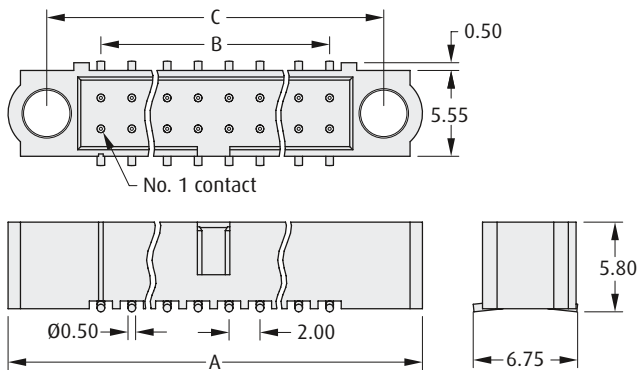

WITH JACKSCREWS

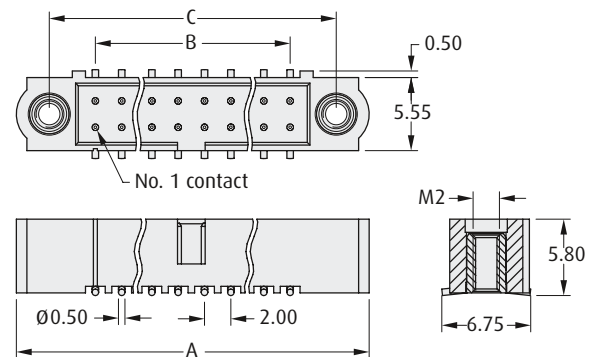

HOW TO ORDER

M80 - 5 X 2 XX XX P

SERIES CODE

TYPE

0	With Jackscrews
2	Without Jackscrews

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

PICK AND PLACE CAP

BLANK	No cap
P	Pick and place cap

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

www.harwin.com

All dimensions in mm.





HARWIN

Datamate Connectors

Male Horizontal Surface Mount

- ❖ Contact datamate@harwin.com for tape & reel options.
- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Stamped contact ensures co-planarity.

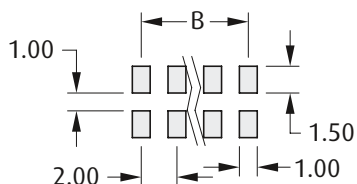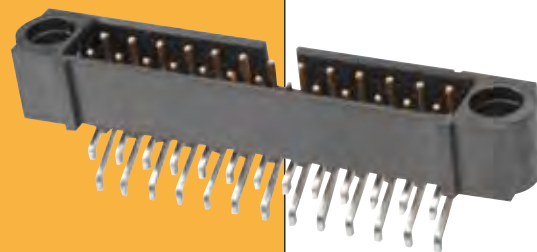


Recommended PC Board Pattern


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITHOUT JACKSCREWS

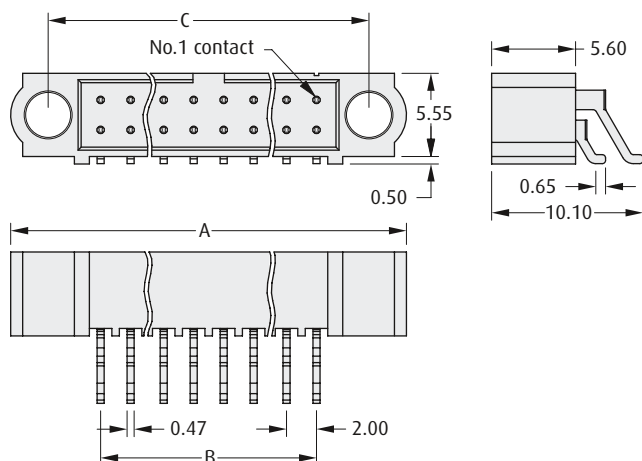

WITH JACKSCREWS

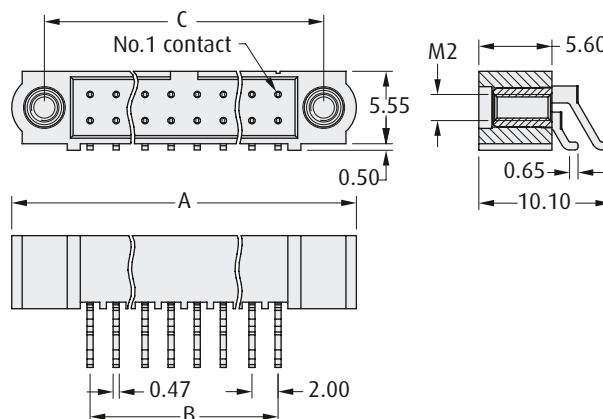

HOW TO ORDER

M80 - 5 X 2 XX XX

SERIES CODE

TYPE

3	With Jackscrews
5	Without Jackscrews

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

All dimensions in mm.

www.harwin.com





Datamate Connectors

Male Surface Mount with Board Mount

- ❖ 3.5mm jackscrew suitable for board thickness up to 1.6mm.
- ❖ 5mm jackscrew suitable for board thickness up to 3.2mm.
- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.



VERTICAL

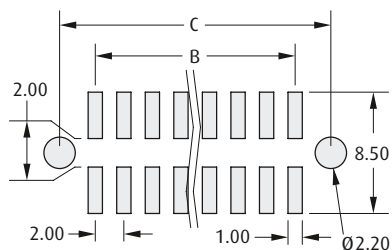
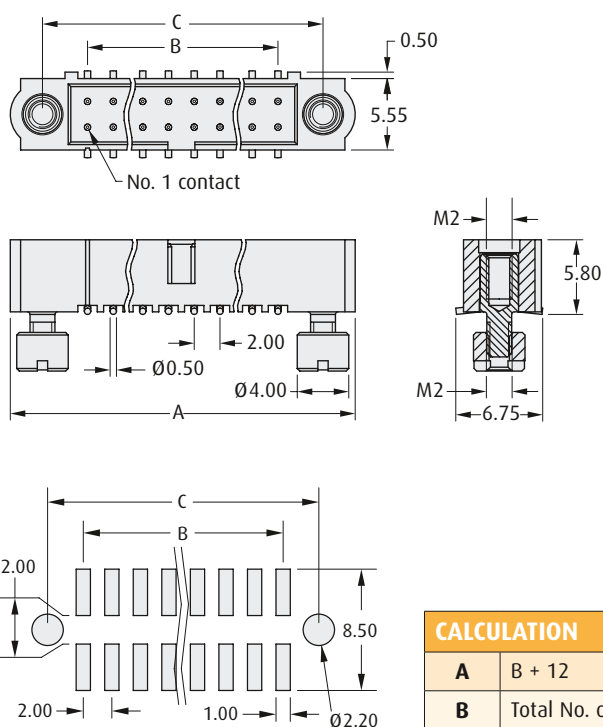


Recommended PC Board Pattern

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

HORIZONTAL

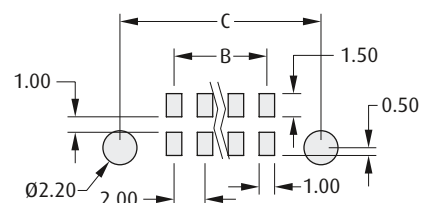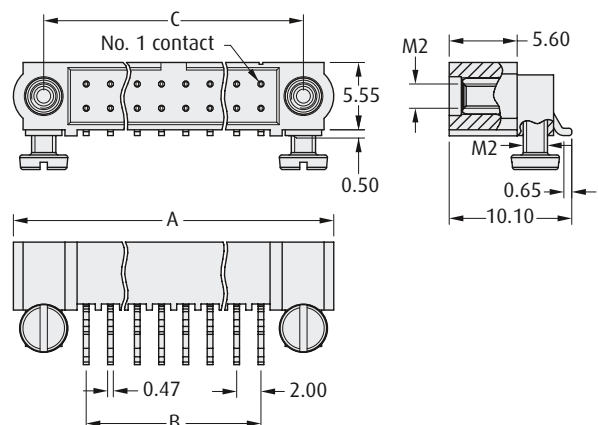

Recommended PC Board Pattern

HOW TO ORDER

M80 - 5 X X XX XX P

SERIES CODE

1 Vertical
4 Horizontal

2 3.5mm Jackscrew
3 5mm Jackscrew

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

PICK AND PLACE CAP

BLANK	No cap
P	Pick and place cap (M80-51X)

FINISH

05	Gold	PG
22	Gold + Tin/Lead	Pb
42	Gold + Tin	PG

www.harwin.com

All dimensions in mm.




HARWIN


Datamate Connectors

Male Crimp


- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Jackscrews are assembled where specified.
- ❖ Crimp contacts supplied loose.
- ❖ Crimp contacts are rear insertable and replaceable.
- ❖ Large bore 22 AWG, small bore 24-28 AWG.
- ❖ Part numbers are for housings and the equivalent no. of contacts.
- ❖ Spare contacts are available – see page 17.

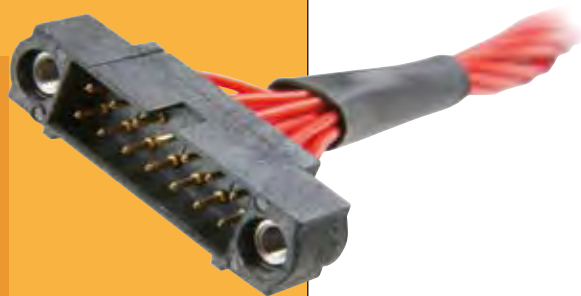

WITHOUT JACKSCREWS

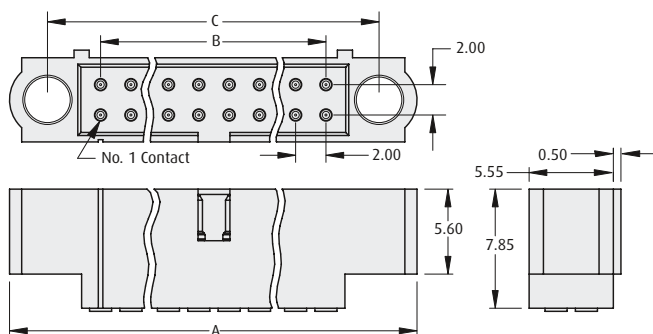

WITH JACKSCREWS

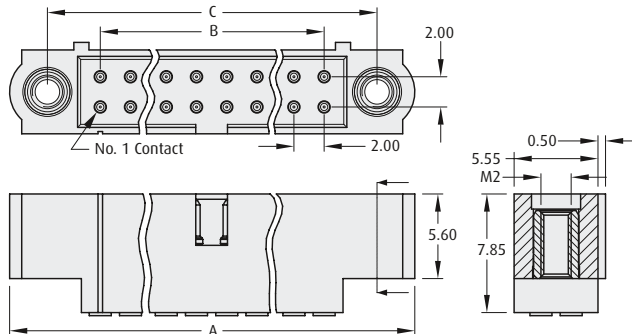


CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

TOOLS

Recommended Crimp Tool – M22520/2-01
Positioner – Z80-193
Contact Insertion/Removal Tool – Z80-280
 See pages 77 to 79
 ➔ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

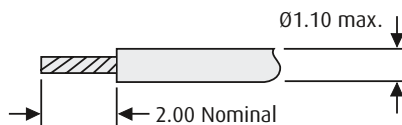

HOW TO ORDER

M80 - XXX XX 05

SERIES CODE

TYPE

560	Large Bore, with Jackscrews	570	Large Bore, without Jackscrews
561	Small Bore, with Jackscrews	571	Small Bore, without Jackscrews

FINISH

05	Gold	
-----------	------	--

TOTAL NO. OF CONTACTS


04 to 50

Even numbers only

All dimensions in mm.

www.harwin.com



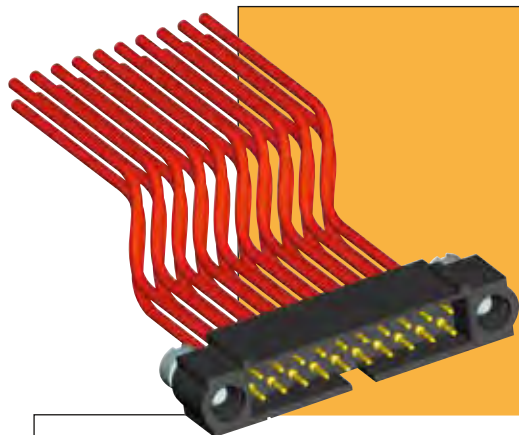


Datamate Connectors

Male Crimp Reverse Fix

- ✦ Mates with female connectors shown on pages 27, 30 and 31.
- ✦ Allows for further flexibility in system design.
- ✦ Crimp contacts supplied loose.
- ✦ Crimp contacts are rear insertable and replaceable.
- ✦ Large bore 22 AWG, small bore 24-28 AWG.
- ✦ Part numbers are for housings and the equivalent number of contacts.
- ✦ Spare contacts are available – see page 17.

WITH JACKSCREWS

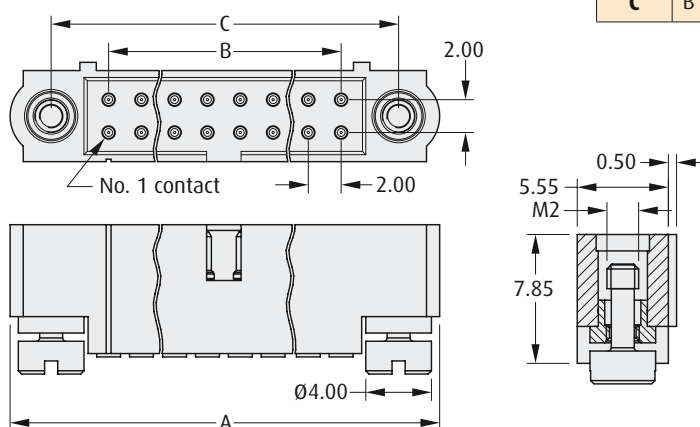

CALCULATION

A	$B + 12$
B	Total No. of contacts – 2
C	$B + 7$

TOOLS

Recommended Crimp Tool – M22520/2-01


Positioner – Z80-193

Contact Insertion/Removal Tool – Z80-280

See pages 77 to 79

✦ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

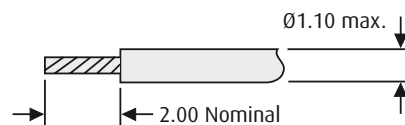

HOW TO ORDER

M80 - XXX XX 05

SERIES CODE

TYPE

562	Large Bore Connector
563	Small Bore Connector

FINISH

05

Gold



TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

www.harwin.com

All dimensions in mm.




HARWIN


Datamate Connectors

Male Crimp Extended Wall

- ❖ Extended Wall Datamate allows back potting to be performed.
- ❖ Cost effective alternative to overmoulding.
- ❖ Fully shrouded contacts.
- ❖ Large bore 22 AWG, small bore 24-28 AWG.
- ❖ Part numbers are for housings and the equivalent no. of contacts.
- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.
- ❖ Spare contacts are available – see page 17.

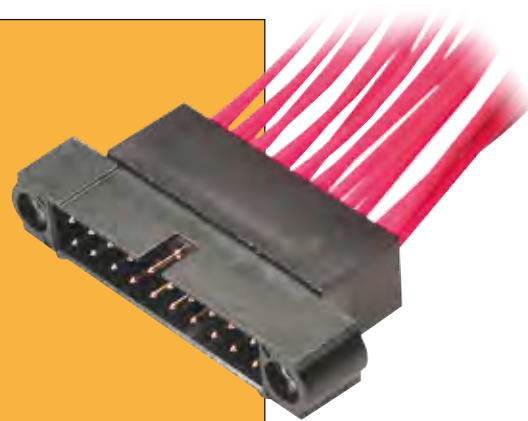


WITHOUT JACKSCREWS

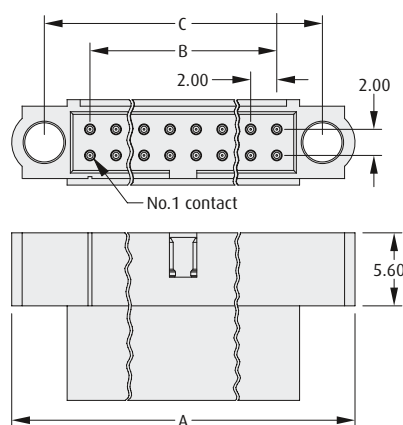

CALCULATION

A	$B + 12$
B	Total No. of contacts - 2
C	$B + 7$

WITH JACKSCREWS

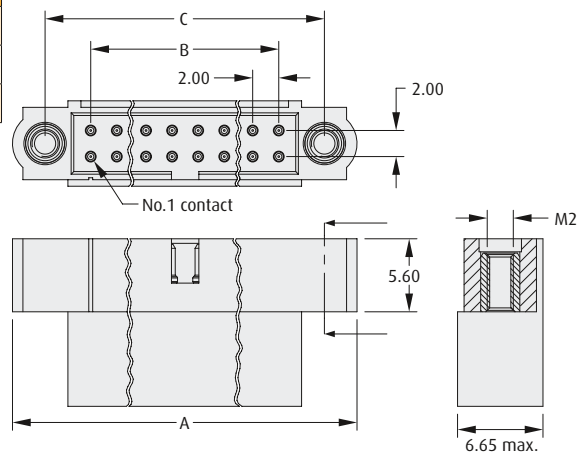

TOOLS

Recommended Crimp Tool – M22520/2-01


Positioner – T5747

Contact Insertion/Removal Tool – Z80-280

See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

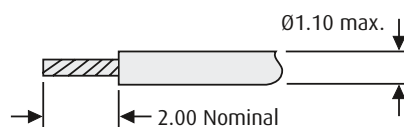

HOW TO ORDER

M80 - XXX XX 05

SERIES CODE

TYPE

565	Large Bore, with Jackscrews	575	Large Bore, without Jackscrews
566	Small Bore, with Jackscrews	576	Small Bore, without Jackscrews

WALL SIZE

BLANK	Wall = 5mm
A	Wall = 1mm

FINISH

05	Gold
-----------	------

TOTAL NO. OF CONTACTS

06, 10, 14, 20, 26, 34

All dimensions in mm.

www.harwin.com





Datamate Connectors

Male Crimp with Hood



- ❖ Supplied as a complete kit, including hood, screws, connector, contacts and jackscrews.
- ❖ For spare crimp contacts, see page 17.
- ❖ Provides strain relief by preventing cable bending at the rear of the connector, and also the option of inserting a cable tie to reduce pull strain.
- ❖ Mates with female connectors shown on pages 26, 28-30 and 32-33.

MALE

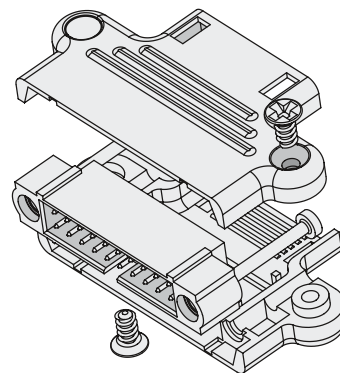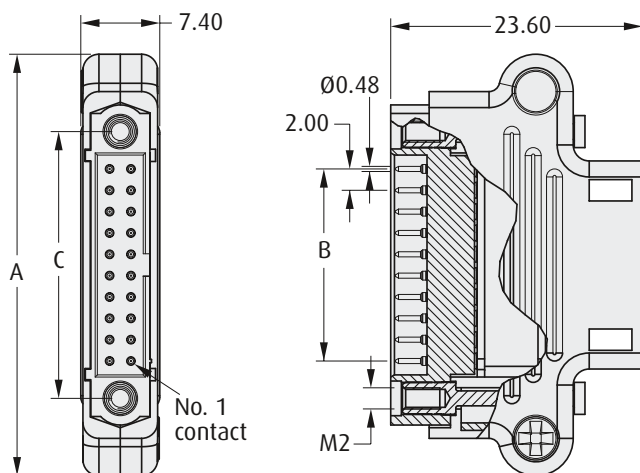

CALCULATION

A	$B + 21.5$
B	Total No. of contacts - 2
C	$B + 7$

TOOLS

Recommended Crimp Tool - M22520/2-01


Positioner - Z80-193

Contact Insertion/Removal Tool - Z80-280

See pages 77 to 79

❖ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS



HOW TO ORDER

M80 - 94 X XX XX

SERIES CODE

TYPE

2	Small Bore
3	Large Bore

FINISH

05

Gold



TOTAL NO. OF CONTACTS

06, 10, 12, 14, 20, 26, 34, 42, 50

www.harwin.com

All dimensions in mm.



HARWIN

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Harwin:

[M80-5603405](#) [M80-4612001](#) [M80-5221022](#) [M80-5604205](#) [M80-4710601](#) [M80-4711401](#) [M80-4702001](#) [M80-4614201](#) [M80-4703401](#) [M80-4705005](#) [M80-4704242](#) [M80-4610642](#) [M80-4611042](#) [M80-4611405](#) [M80-4611442](#) [M80-4712005](#) [M80-4605005](#) [M80-4604242](#) [M80-4711042](#) [M80-4711405](#) [M80-4711442](#) [M80-4702042](#) [M80-4614242](#) [M80-4703405](#) [M80-4702642](#) [M80-4612042](#) [M80-4600642](#) [M80-4600605](#) [M80-5221042](#) [M80-5222042](#) [M80-5225042](#) [M80-4650605](#) [M80-4651005](#) [M80-4653405](#) [M80-4654205](#) [M80-4660605](#) [M80-4661005](#) [M80-4663405](#) [M80-4664205](#) [M80-4750605](#) [M80-4751005](#) [M80-4753405](#) [M80-4754205](#) [M80-4760605](#) [M80-4761005](#) [M80-4763405](#) [M80-4764205](#) [M80-4800605](#) [M80-4800642](#) [M80-4801005](#) [M80-4801042](#) [M80-4801405](#) [M80-4801442](#) [M80-4802005](#) [M80-4802042](#) [M80-4802605](#) [M80-4802642](#) [M80-4803405](#) [M80-4803442](#) [M80-4804205](#) [M80-4804242](#) [M80-4805005](#) [M80-4805042](#) [M80-4810605](#) [M80-4810642](#) [M80-4811005](#) [M80-4811042](#) [M80-4811405](#) [M80-4811442](#) [M80-4812005](#) [M80-4812042](#) [M80-4812605](#) [M80-4812642](#) [M80-4813405](#) [M80-4813442](#) [M80-4814205](#) [M80-4814242](#) [M80-4815005](#) [M80-4815042](#) [M80-5014242](#) [M80-5114242](#) [M80-5204242](#) [M80-5214242](#) [M80-5304242](#) [M80-5314242](#) [M80-5404242](#) [M80-5514242](#) [M80-4630605](#) [M80-4632005](#) [M80-5630605](#) [M80-5632005](#) [M80-4611205](#) [M80-4611242](#) [M80-4613805](#) [M80-5601005](#) [M80-5601405](#) [M80-5602005](#) [M80-4705001](#) [M80-5610605](#) [M80-4610601](#)