


Toggle

SINGLE POLE



- 6.3mm tabs or Screw Terminals
- 10A, 250V a.c.

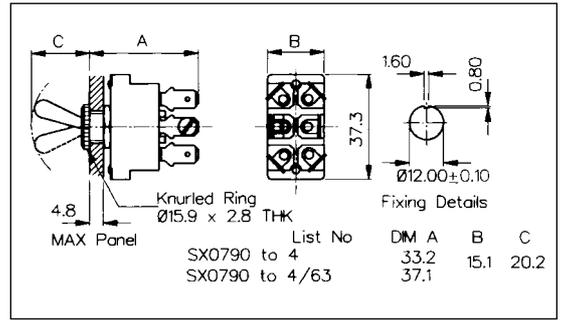

Single Pole List No.	Description	1 	2 	3 
SX0790	Change-over. Centre off	ON	OFF	ON
SX0791	Change-over. Centre off One position biased off	ON	OFF	ON
SX0792	Change-over. Centre off Two position biased off	ON	OFF	ON
SX0793	Change-over Two positions only	ON	-	ON
SX0794	ON/OFF Two positions only	OFF	-	ON


Specification	SX0790 Series
Terminations:	Screw Terminals
Switching:	See table for types Slow Make, Slow Break
Max. Rating:	10A, 250V a.c. 10A, 0-28V d.c. (non-reactive circuits)
Contact Resistance:	<10mΩ
Insulation Resistance:	>10 ³ MΩ
Dielectric Strength:	>2.5kV a.c.
Operating Temp. Range:	-20°C to +85°C
Materials:	
Mouldings:	Glass Filled Polyester
Tags:	Brass, Silver Plated
Contacts:	Copper with Silver face
Variants:	/63 (6.3mm tabs) - (except SX0791)
Accessories:	SX0550 (see page 195)
RoHS	Compliant

Toggle

DOUBLE POLE



- 6.3mm tabs or Screw Terminals
- 10A, 250V a.c.

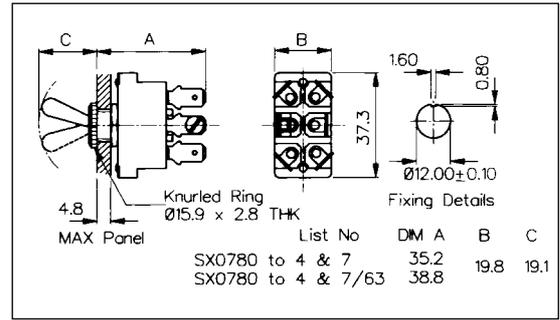

Double Pole List No.	Description	1	2	3
SX0780	Change-over. Centre off	ON	OFF	ON
SX0782	Change-over. Centre off Two position biased off	ON	OFF	ON
SX0783	Change-over Two positions only	ON	-	ON
SX0784	ON/OFF Two positions only	OFF	-	ON
SX0787	Change-over. Two positions only biased to one position	ON	-	ON

Specification	SX0780 Series
Terminations:	Screw Terminals
Switching:	See table for types Slow Make, Slow Break
Max. Rating:	10A, 250V a.c. 10A, 0-28V d.c. (non-reactive circuits)
Contact Resistance:	<10mΩ
Insulation Resistance:	>10 ³ MΩ
Dielectric Strength:	>2.5kV a.c.
Operating Temp. Range:	-20°C to +85°C
Materials:	
Mouldings:	Glass Filled Polyester
Tags:	Brass, Silver Plated
Contacts/Terms:	Copper with Silver face
Variants:	/63 (6.3mm tabs)
Accessories:	SX0550 (see page 195)
RoHS	Compliant