



Features

- Small size
- Low insertion loss
- High selectivity
- Hermetic seal

Applications

• GNSS

How to Order


<u>SF</u> <u>14</u> - <u>1575</u> <u>M</u> <u>5</u> <u>UB</u> <u>A1</u> <u>1</u> <u>3</u> <u>4</u> <u>5</u> <u>6</u> <u>7</u>

- 1) Type of Product (SAW Filter)
- 2 Package Size
- ③ Nominal Center Frequency
- 4 Spec.
- (5) Number of Terminals
- 6 Input/ Output
- 7 Custom Specification


Specifications

| Part No. | Output | Application | Pass Band Frequency | | Pass Band Variation (dB) | VSWR (In/ Out) | Absolute Rejection (dB) | | | | Operating Temperature | Storage Temperature | | |
|-------------------|------------|---------------------------|-------------------------------|------------------|-----------------------------|--|-------------------------|-------------------------------|-------------------------------|------------------------------------|-------------------------------|-------------------------|--------------|----------------|
| SF14-1575M5UBA1 | | GPS Rx | 1574.42MHz | 1.6 max. | 1.0 max. | 1.6 max. | 810MHz 960MHz | 1429MHz 1453MHz | 1501MHz 1525MHz | 1920MHz 1980MHz | 1980MHz 2400MHz | 2400MHz 2500MHz | | |
| | Balanced | | 1576.42MHz | | | 1.6 max. 1.8 max. / 1.0 max. / 1.8 max. | 50 min. 810MHz | 35 min. 1429MHz | 27 min. 1453MHz | 41 min. 1625MHz | 29 min. 1920MHz | 46 min. 1980MHz | | C -40 to +85°C |
| SF14-1575M5UBB1 | | GPS Rx | 1574.42MHz - 1576.42MHz | 2.0 max. 1.0 m | 1.0 max. | | 960MHz 50 min. | 1453MHz | 1525MHz | 1920MHz 23 min. | 1980MHz | 5000MHz 35 min. | | |
| SF14-1575F5UUA1 | - | GPS Rx GPS Rx | 1573.92MHz | 1.2 max. | 0.6 max. | 1.7 max. | 843MHz 925MHz | 35 min. 1429MHz 1501MHz | 30 min. 1501MHz 1525MHz | 1920MHz 1980MHz | 50 min. 1980MHz 2500MHz | 2500MHz | | |
| 01 14 10/01 000A1 | | | 1576.92MHz | | | 1.7 max. | 40 min. | 38 min. | 30 min. | 40 min. | 40 min. | 35 min. | _ | |
| SF14-1575F5UUC1 | | | 1574.42MHz - 1576.42MHz | 0.8 max. | | 1.8 max. / 1.8 max. | 960MHz | 1500MHz 1525MHz | | 2170MHz | _ | _ | -30 to +85°C | |
| | Unbalanced | GPS GLONASS COMPASS | 1574.39MHz - 1576.45MHz | 1.5 max. | nax. | 2.0 max. / 2.0 max. | - | 925MHz - 960MHz | - | 20 min. 1850MHz - 1910MHz | - | 2401MHz - 2483MHz | | |
| SF14-1582M5UUD2 | | | 1565.19MHz 1585.65MHz | 2.0 max. | | 2.0 max. 2.0 max. | | | | | | | | |
| | | | 1559.05MHz - 1563.15MHz | 2.3 max. | | 2.2 max. / 2.3 max. | | | | | | | | |
| | | | 1597.55MHz 1605.89MHz | 2.2 max. | 2.0 max. 2.0 max. | 40 min. | 40 min. | 40 min. | 37 min. | 39 min. | 38 min. | _ | | |


Dimensions

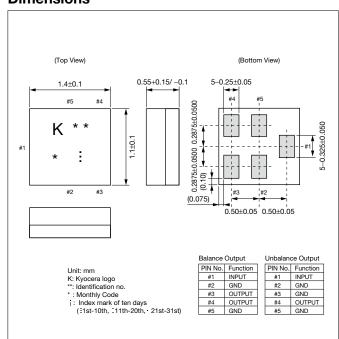

Recommended Land Pattern

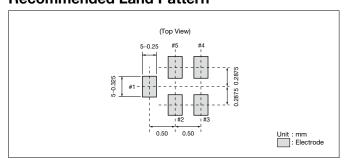

Test Circuit

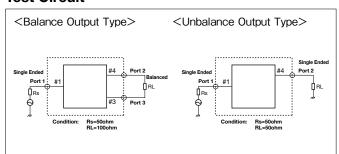


GNSS RF SAW Filters SF14 Series




Characteristics


Part No.: SF14-1575M5UBA1

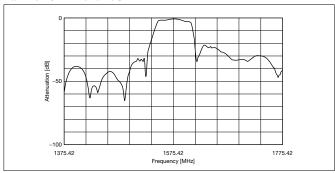


Part No.: SF14-1575M5UBB1

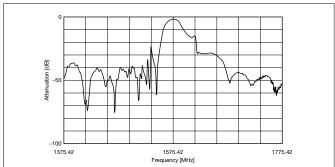


Part No.: SF14-1575F5UUA1

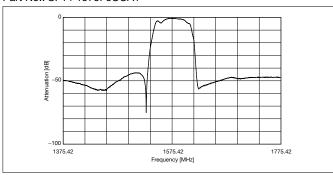


Part No.: SF14-1575F5UUC1

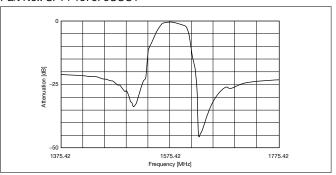

Part No.: SF14-1582M5UUD2

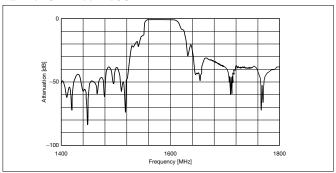

Recommended Reflow Profile

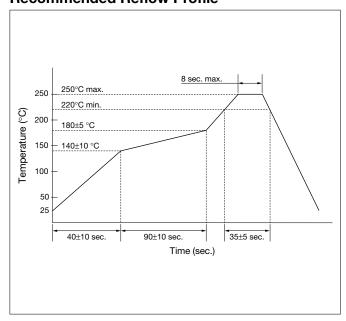

SAW Devices Precautions



1. Operating Environment

- Use products within the rated operating temperature, otherwise it may not satisfy electrical characteristics specifications. It might work initially, but there is a high possibility that it will cause degradation, breakdown and lower reliability.
- 2) This product is designed and manufactured with intention to be used in electronic devices for standard applications, but not in the following environment which may affect performance of the product. Be sure not to use products in the following conditions which may cause electrical characteristics and reliability degradation.
 - Under corrosive gas (Cl₂, H₂S, NH₃, SOx, NOx, etc.)
 - · Under volatile and inflammability gas
 - · Dusty environment
 - · Direct exposure to water, or high humidity environment
 - · Direct sunlight
 - · High static electricity, or high electric intensity.

Please consult with us if you intend to use products in the above environment.

- 3) This product can not be used in liquid such as water, oil, chemical and organic solvent.
- 4) Operate under rated voltage, otherwise it may not satisfy electrical characteristics specifications. It might work initially, but there is high possibility that it will cause degradation, breakdown and lower the reliability.
- 5) Avoid contact with other components on the board, since outer resin is not intended for the insulation with other components.
- 6) There might be a strong electrical charge when rapid thermal change is applied to this product. This charge may damage the product and the peripheral circuit. Therefore, insert load discharge path between input/output and ground.
- 7) Do not apply larger load greater than the one loaded in the environmental test. It might work initially, but there is a high possibility that it will cause degradation, breakdown and lower the reliability.
- 8) Do not use transfer mold for this product. It may break hermetic seal and cause abnormal operation. Please consult us when molding by resin.



2. Storage instructions

- 1) Do not store products in the following environment which may deteriorate solderability.
 - · Under corrosive gas (Cl₂, H₂S, NH₃, SOx, NOx, etc.)
 - · Under volatile and inflammability gas
 - · Dusty environment
 - · Direct exposure to water, or high humidity environment
 - · Direct sunlight
 - · High static electricity, or high electric intensity

Please consult with us if you intend to use products in the above environment.

- 2) Store products under normal temperature and humidity in the sealed or unopened package. Storage of products for over 12months after shipment may deteriorate solderability, and it is advised to perform solderability test before use. Also, be cautioned that color of electrode might change after a long term storage.
- 3) Open the sealed pack just before use. Practice assembly within 168 hours after opening the pack, and in the condition of 5-30deg.C and below 60%RH.
- 4) Stacking the box too high may cause fall over. It is advised to stack the box at the maximum of 5 boxes.

3. Handling instructions

- 1) Do not apply larger vibration or shock greater than specified, since it may cause degradation, breakdown and lower reliability.
- 2) Do not apply larger shock or load greater than specified, while carrying the board with products mounted.
- 3) Take appropriate measure to avoid static electricity and high voltage when handling products, since it may cause degradation or damage to the products.
- 4) Do not handle this product with bear hands.

4. Assembly instructions

- Place products in the place to avoid stress from bending and camber of the board.
 There may be a large stress or shock when the product is placed near the connection parts with other outer parts.
- 2) Please do not apply larger stress greater than the one loaded in the environmental test when mounting on the board.
- 3) Make sure to solder all electrodes to the board, otherwise it may cause lower electrode strength.



Tape & Reel Specifications

■ SAW Duplexers/ SAW Filters

(Unit: mm)

| | | SAW Du | ıplexers | SAW Filters | | | | | | | |
|-------------|-----|--------------|----------|-------------|----------|-----------|--------------|----------|--|--|--|
| | | SD18 | SD20 | SF14 | SF15 | SF16 | SF18 | SF20 | | | |
| | Α | 2.0±0.05 | 2.0±0.05 | 2.0±0.05 | 2.0±0.05 | 2.0±0.05 | 2.0±0.05 | 2.0±0.05 | | | |
| | В | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | | | |
| | С | φ1.5+0.1/ -0 | 1.5±0.1 | φ1.5±0.1 | 1.5±0.1 | 1.5±0.1 | φ1.5+0.1/ -0 | 1.5±0.1 | | | |
| | D | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | 4.0±0.1 | | | |
| т | E | 3.5±0.05 | 3.5±0.05 | 3.5±0.05 | 3.5±0.05 | 3.5±0.05 | 3.5±0.05 | 3.5±0.05 | | | |
| Ä | F | 1.75±0.1 | 1.75±0.1 | 1.75±0.1 | 1.75±0.1 | 1.75±0.1 | 1.75±0.1 | 1.75±0.1 | | | |
| P | G | 8.0±0.1 | 8.0±0.2 | 8.0±0.2 | 8.0±0.2 | 8.0±0.2 | 8.0±0.1 | 8.0±0.2 | | | |
| _ | Н | φ0.8±0.05 | 1.1±0.1 | ф0.5±0.05 | 0.5±0.1 | 1.1±0.1 | ф0.8±0.05 | 1.1±0.1 | | | |
| | J | 2.05±0.1 | 2.25±0.1 | 1.7±0.1 | 1.80±0.1 | 1.90±0.1 | 2.05±0.1 | 2.25±0.1 | | | |
| | L | 1.7±0.1 | 1.8±0.1 | 1.4±0.1 | 1.4±0.1 | 1.85±0.1 | 1.7±0.1 | 1.8±0.1 | | | |
| | N | 0.85+0/ -0.5 | 0.7±0.1 | 0.8±0.1 | 0.7±0.1 | 0.95±0.2 | 0.85+0/ -0.5 | 0.7±0.1 | | | |
| | 0 | 0.2±0.05 | 0.2±0.05 | 0.2±0.05 | 0.2±0.05 | 0.25±0.05 | 0.2±0.05 | 0.2±0.05 | | | |
| | Р | φ178±2 | φ178±2 | φ178±2 | φ178±2 | φ178±2 | φ178±2 | φ178±2 | | | |
| R | Q | φ60±2 | φ60±2 | φ60±2 | φ60±2 | φ60±2 | φ60±2 | φ60±2 | | | |
| E E L | R | φ13±0.2 | φ13±0.2 | φ13±0.2 | φ13±0.2 | φ13±0.2 | φ13±0.2 | φ13±0.2 | | | |
| | S | φ21±0.8 | φ21±0.8 | φ21±0.8 | φ21±0.8 | φ21±0.8 | φ21±0.8 | φ21±0.8 | | | |
| | U | 2±0.5 | 2±0.5 | 2±0.5 | 2±0.5 | 2±0.5 | 2±0.5 | 2±0.5 | | | |
| | W | 9.5±1 | 9.5±1 | 9.5±1 | 9.5±1 | 9.5±1 | 9.5±1 | 9.5±1 | | | |
| Q | ty. | 3000 | 3000 | 3000 | 3000 | 3000 | 3000 | 3000 | | | |

